


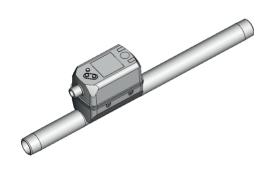

Operating instructions testo compressed air meter

0555 6451 0555 6452 0555 6453 0555 6454



Contents

1	Preliminary note	5
	1.1 Symbols used	5
	1.2 Warnings used	5
	1.3 Safety instructions	5
2	Functions and features	7
_	2.1 Pressure Equipment Directive (PED)	
	, ,	
3	Function	
	3.1 Processing of the measured signals	8
	3.2 Analogue output	
	3.3 Consumed quantity monitoring	
	3.3.1 Meter reading	
	3.3.2 Counter reset	
	3.4 Measured value damping	
	3.5 Low flow cut-off	
	3.6 Simulation	
	3.7 Colour of the characters in the display	.13
4	Installation	14
•	4.1 Installation location	
	4.2 Installation position	
	4.2.1 Inlet and outlet pipe lengths	
	4.2.2 Orientation	
	4.3 Installation in pipes	
_		
	Electrical connection	
6	Operating and display elements	.18
7	Menu	.19
•	7.1 Process value display (RUN)	
	7.2 Main menu and Extended functions (EF)	
	7.3 Submenu OUT1, OUT2, CFG	
	7.4 Submenu MEM, DIS	
	7.5 Submenu COLR, SIM	
	7.6 Explanation of the menu	
	7.6.1 Submenu OUT1 and OUT2	
	7.6.2 Submenu CFG	

	7.6.3 Submenu MEM	24
	7.6.4 Submenu DIS	25
	7.6.5 Submenu COLR	25
	7.6.6 Submenu SIM	26
8	3 Set-up	26
9	Parameter setting	27
	9.1 Parameter setting in general	27
	9.1.1 Select submenu	
	9.1.2 Change to the process value display (RUN mode)	28
	9.1.3 Lock / unlock	
	9.1.4 Timeout	28
	9.2 Settings for volumetric flow monitoring	28
	9.2.1 Analogue signal volumetric flow OUT1 or OUT2	28
	9.3 Settings for consumed quantity monitoring	28
	9.3.1 Manual counter reset	28
	9.3.2 Time-controlled counter reset	29
	9.3.3 Deactivation of the counter reset	29
	9.4 Settings for temperature monitoring	29
	9.4.1 Analogue signal temperature OUT1 or OUT2	29
	9.5 Settings for pressure monitoring	29
	9.5.1 Analogue signal pressure OUT1 or OUT2	29
	9.6 User settings (optional)	30
	9.6.1 Standard display	30
	9.6.2 Standard unit of measurement for volumetric flow	30
	9.6.3 Standard unit of measurement for temperature	30
	9.6.4 Standard unit of measurement for pressure	30
	9.6.5 Measured value damping	
	9.6.6 Low flow cut-off	31
	9.6.7 Standard conditions	
	9.6.8 Zero-point calibration pressure	
	9.6.9 Colour of the characters in the display	
	9.6.10 Error behaviour of the outputs OUT1 or OUT2	
	9.6.11 Restore factory setting	
	9.7 Diagnostic functions	
	9.7.1 Read min/max values	
	9.7.2 Simulation	34

10	Operation	34
11	Error correction	34
12	Maintenance, repair and disposal	36
13	Factory setting	36

1 Preliminary note

1.1 Symbols used

- Instructions
- > Reaction, result
- [...] Designation of keys, buttons or indications
- → Cross-reference
- Important note
 - Non-compliance may result in malfunction or interference.
- Information
 - Supplementary note.

1.2 Warnings used



CAUTION

Warning of personal injury.
Slight reversible injuries may result.

1.3 Safety instructions

- The device described is a subcomponent for integration into a system.
 - The manufacturer is responsible for the safety of the system.
 - The system manufacturer undertakes to perform a risk assessment and to create a documentation in accordance with legal and normative requirements to be provided to the operator and user of the system. This documentation must contain all necessary information and safety instructions for the operator, the user and, if applicable, for any service personnel authorised by the manufacturer of the system.
- Read this document before setting up the product and keep it during the entire service life.
- The product must be suitable for the corresponding applications and environmental conditions without any restrictions.
- Only use the product for its intended purpose (→ Functions and features).
- Only use the product for permissible media (→ Technical data).

- If the operating instructions or the technical data are not adhered to, personal injury and/or damage to property may occur.
- The manufacturer assumes no liability or warranty for any consequences caused by tampering with the product or incorrect use by the operator.
- Installation, electrical connection, set-up, operation and maintenance of the unit
 must be carried out by qualified personnel authorised by the machine operator.
- Protect units and cables against damage.

2 Functions and features

The unit monitors the standard volume flow of compressed air in industrial use.

It detects the 5 process variables flow velocity, volumetric flow quantity, consumed quantity, medium temperature and pressure.

All indications apply to standard volume flow to DIN ISO 2533, i.e. volume flow at 1013 mbar, 15 $^{\circ}$ C and 0 $^{\circ}$ relative air humidity. The unit can be set to different standard conditions (\rightarrow 9.6.7).



This is a class A product. This product may cause radio interference in domestic areas.

▶ If required, take appropriate EMC screening measures.

2.1 Pressure Equipment Directive (PED)

The units comply with the Pressure Equipment Directive. They are designed for stable gases of group 2 fluids and manufactured in accordance with sound engineering practice.

3 Function

- The volumetric flow is monitored by a calorimetric measuring system, the measured signals are evaluated by the electronics.
- The unit detects the pressure and the media temperature of the volumetric flow as additional process values.
- · The unit displays the current process values.
- The unit has many self-diagnostic options.
- · A simulation mode allows simplified set-up of the sensor.

3.1 Processing of the measured signals

The unit generates 2 output signals according to the parameter setting:

OUT1: 5 selection options

- analogue signal for volumetric flow quantity
- analogue signal for temperature
- analogue signal for pressure
- OFF (output switched to high impedance)

OUT2: 4 selection options

- analogue signal for volumetric flow quantity
- analogue signal for temperature
- analogue signal for pressure
- OFF (output switched to high impedance)

3.2 Analogue output

The unit provides an analogue signal that is proportional to the volumetric flow quantity, the medium temperature or the pressure.

Within the measuring range the analogue signal is 4...20 mA.

The measuring range is scalable:

- [ASPx] determines at which measured value the output signal is 4 mA.
- [AEPx] determines at which measured value the output signal is 20 mA.



Minimum distance between [ASPx] and [AEPx] = 20 % of the final value of the measuring range.

If the measured value is outside the measuring range or in the event of an internal error, the current signal indicated in Fig. 1 is provided.

For measured values outside the display range or in case of a fault, messages are displayed (cr.UL, UL, OL, cr.OL, Err; \rightarrow 11).

The analogue signal in case of a fault is adjustable (\rightarrow 9.6.10):

- [FOU] = On determines that the analogue signal goes to the upper final value (21.5 mA) in case of an error.
- [FOU] = OFF determines that the analogue signal goes to the lower final value (3.5 mA) in case of an error.
- [FOU] = OU defines that the analogue signal goes to the upper final value (21.5 mA) in case of a pressure measurement error and to the lower final value (3.5 mA) in case of a flow / temperature measurement error.

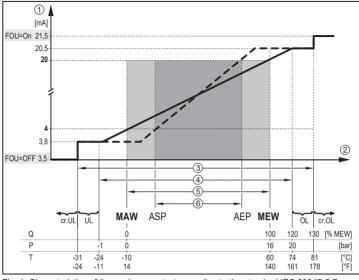


Fig. 1: Characteristics of the analogue output according to the standard IEC 60947-5-7.

- 1 2 3 4 analogue signal
- measured value (volumetric flow, temperature or pressure)
- detection zone
- display range
- <u>(5)</u> measuring range
- (6) scaled measuring range

Q: flow Р٠ pressure

temperature

MAW: initial value of the measuring range for non-scaled measuring range (With setting of a low-flow cut for Q: signal output starting at MAW + LFC \rightarrow 3.5.)

MEW: final value of the measuring range for non-scaled measuring range

ASP: analogue start point with scaled measuring range AEP: analogue end point with scaled measuring range

below the display range UI · OL: above the display range

cr.UL: below the detection zone (error)

cr.OL: above the detection zone (error)

3.3 Consumed quantity monitoring

The unit has an internal quantity meter (totaliser). It continuously sums up the consumed quantity and provides this process value on the display.

3.3.1 Meter reading

The current quantity meter count can be indicated (\rightarrow 7.1).

In addition, the value before the last reset is saved. This value and the time since the last reset can also be displayed (\rightarrow 7.1).



The meter saves the totalled volumetric flow quantity every 10 minutes. After a power failure this value is available as the current meter reading. If a time-controlled reset is set, the elapsed time of the set reset interval is also saved. So the possible data loss can be at most 10 minutes.

3.3.2 Counter reset

The setting of the parameter [rTo] defines by which method the quantity meter is reset:

[rTo]	Counter reset
OFF (→ 9.3.3)	The preset counter is only reset - when a manual reset is made (\rightarrow 10.3.1) or - when the maximum display range has been exceeded (99.999.999).
1, 2, h 1, 2, d 1, 2, w (→ 9.3.2)	The preset counter is automatically reset when the time has elapsed and the count starts again (\rightarrow 9.3.2 Time-controlled counter reset).



The accuracy of the consumed quantity measurement depends on the accuracy of the flow measurement.

3.4 Measured value damping

The damping time [dAP.F] und [dAP.P] allows to set after how many seconds the output signal has reached 63 % of the final value if the flow value / the pressure value changes suddenly. The set damping time stabilises the analogue outputs and the display.

The damping time is added to the response time of the sensor (\rightarrow Technical data).

The signals UL, crUL, OL and crOL (\rightarrow 11) are defined under consideration of the damping time.

3.5 Low flow cut-off

With the function low flow cut-off [LFC] it is possible to suppress small volumetric flow quantities. Flows below the LFC value are evaluated by the sensor as standstill (Q = 0).

3.6 Simulation

With this function, the process values flow, temperature, pressure and meter reading of the totaliser are simulated and their signal chain is reviewed.

When the parameters cr.UL, UL, OL und cr.OL are set, the process values that lead to an error message or warning can be simulated (\rightarrow 11).

When the simulation is started, the values of the totaliser are frozen and the simulated totaliser is set to 0. The simulated flow value then has an effect on the simulated totaliser. When the simulation is ended, the initial totaliser values are restored


- í
- The simulation does not have any effect on the currently existing process values. The outputs operate as previously set.
- <u>î</u>
- During the simulation the original totaliser value remains saved without any changes even if there is a real flow.
- ı́

During the simulation operation, no error message of the currently real application is available. They are suppressed by the simulation.

3.7 Colour of the characters in the display

The colour of the characters in the display can be set via the parameter [coL.x]:

- · Permanent definition of the display colour:
 - bk/wh (black/white)
 - yellow
 - green
 - red
- Colour change from red to green or vice versa (Fig. 2):
 - r-cF (red display colour between the limits cFL...cFH)
 - G-cF (green display colour between the limits cFL...cFH)

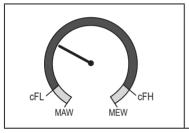

cFL = lower limit cFH = upper limit

MAW = initial value of the measuring range MEW = final value of the measuring range

Fig. 2: Colour setting window function



The limits can be freely selected within the measuring range and are independent of the output function set for OUT1 and OUT2.

4 Installation



CAUTION

If the medium temperature is above 50 °C (122 °F), parts of the housing can increase in temperature to over 65 °C (149 °F).

- > Risk of burns.
- ▶ Protect the housing against contact with flammable substances and unintentional contact
- ▶ Apply the supplied warning label to the sensor cable.



- ▶ Ensure that the system is free of pressure during installation.
- ► Ensure that the system is not on process.

 The rules and regulations for the installation and operation of compressed air equipment must be observed.

4.1 Installation location

- ▶ Install the unit downstream of the cold dryer.
- Install the unit near the load
- ▶ The unit can be installed downstream of a maintenance unit.
- ▶ If oil is used for the loads: install the unit upstream of the oiler.

4.2 Installation position

4.2.1 Inlet and outlet pipe lengths

Structures in the pipe, bends, valves, reducing pieces and the like affect the function of the unit

► Adhere to the distances between sensor and interference:

Interference		Distance to the sensor
	changes to the pipe diameter	10 x pipe diameter
	90° elbow	10 x pipe diameter
	two 90° elbows, one plane	15 x pipe diameter

Interference		Distance to the sensor
	two 90° elbows, two planes	25 x pipe diameter
	valve, slide	40 x pipe diameter

Shut-off valves and control devices are not allowed directly in front of the unit.

4.2.2 Orientation


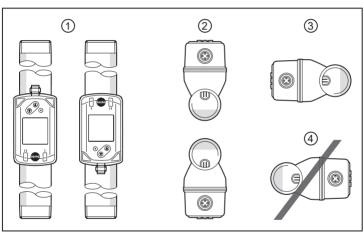


Fig. 1: Orientation of the pipe length and the unit

- 1: pipe length vertical, unit any
- 2: pipe length horizontal, unit vertical
- 3: pipe length right, unit on side
- 4: avoid: pipe length left, unit on side

4.3 Installation in pipes

 ▶ Fit the unit in the pipe in accordance with the flow direction (arrow on the unit):




▶ Tighten both adapters in opposite direction by applying the defined tightening torque:

Туре	Tightening torque
0555 6451; 0555 6452	100 Nm
0555 6453; 0555 6454	150 Nm

5 Electrical connection

 - The device must be connected by a qualified electrician. Voltage supply according to EN 50178, SELV, PELV.
- ▶ Disconnect power.
- ▶ Connect the unit as follows:




Colours to DIN EN 60947-5-2

BK: black; BN: brown; BU: blue; WH: white

Pin	Connection
4 (OUT1)	analogue signal for volumetric flow analogue signal for temperature analogue signal for pressure OFF
2 (OUT2)	analogue signal for volumetric flow analogue signal for temperature analogue signal for pressure OFF

6 Operating and display elements

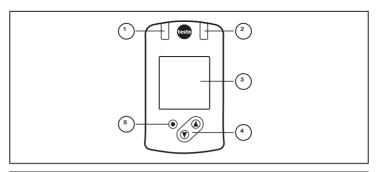

1 and 2: LEDs

Without function

3: TFT display

- Display of the current process values (volumetric flow quantity, temperature, pressure, totaliser)
- Display of the parameters and parameter values

4: [▲] and [▼] buttons

- · Select parameter
- Change parameter value (hold button pressed)
- Change of the display unit in the normal operating mode (RUN mode)
- Lock / Unlock (buttons pressed simultaneously > 10 seconds)

5: [●] = Enter button

- Change from the RUN mode to the main menu
- · Change to the setting mode
- · Acknowledge the set parameter value



Display illumination:


- unit temperature > 70°C: brightness automatically reduced.
- unit temperature ≥ 100°C: display automatically switched off.

7 Menu

7.1 Process value display (RUN)


It is possible to select three process value indications during operation:

- ▶ Press [▲] or [▼].
- > The display changes between the standard indication and two other views.
- > After 30 s, the device returns to the standard display.

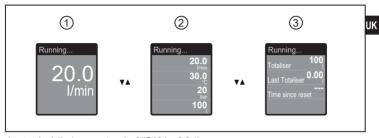


- 1: standard display as set under [diS.L] (\rightarrow 9.6.1)
- 2: overview of all process values
- 3: overview totaliser values


7.2 Main menu and Extended functions (EF)

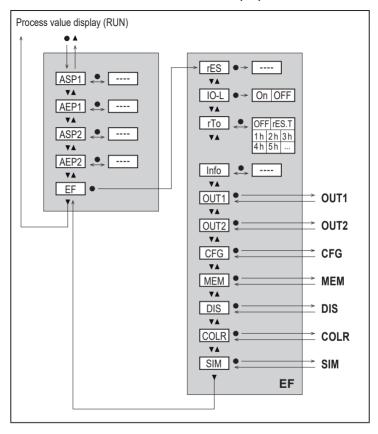


7.3 Submenu OUT1, OUT2, CFG

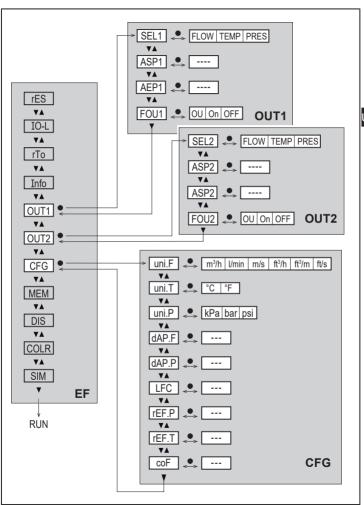

7.4 Submenu MEM, DIS

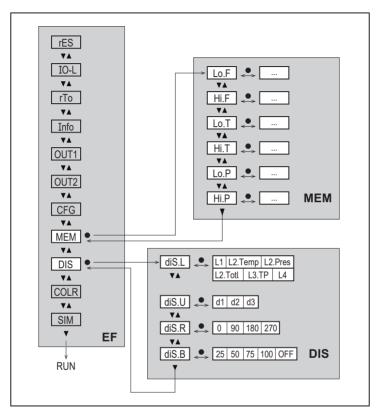

7.5 Submenu COLR, SIM

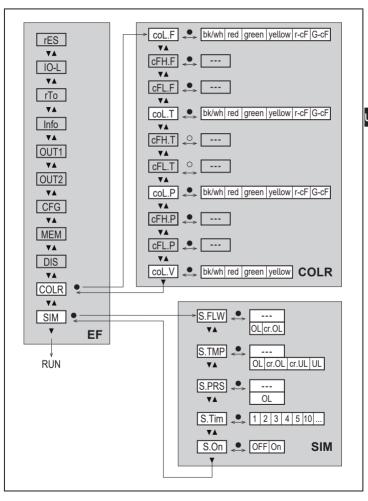

7.6 Explanation of the menu

7.6.1 Submenu OUT1 and OUT2

Parameter	Explanation and setting options
SELx	standard unit of measurement for evaluation by OUTx: FLOW (volumetric flow) or TEMP (temperature) or PRES (pressure)
ASPx	analogue start point for OUTx
AEPx	analogue end point for OUTx
FOUx	response of OUTx in case of an internal fault: OU = analogue signal goes to 21.5 mA in case of a pressure measurement error and to 3.5 mA in case of a flow or temperature measurement error. On = analogue signal goes to 21.5 mA. OFF = analogue signal goes to 3.5 mA.

7.6.2 Submenu CFG

Parameter	Explanation and setting options
uni.F	standard unit of measurement for volumetric flow
uni.T	standard unit of measurement for temperature
uni.P	standard unit of measurement for pressure
dAP.F	measured value damping for volumetric flow
dAP.P	measured value damping for pressure
LFC	low flow cut-off
rEF.P	standard pressure to which the measured and display values for volumetric flow refer
rEF.T	standard temperature to which the measured and display values for volumetric flow refer
coF	Zero-point calibration for pressure measurement. The internal measured value "0" is shifted by this value.

7.6.3 Submenu MEM

Parameter	Explanation and setting options	
Lo.F	min. value of the flow volume measured in the process	
Hi.F	max. value of the flow volume measured in the process	
Lo.T	min. value of the temperature measured in the process	

Parameter	Explanation and setting options
Hi.T	max. value of the temperature measured in the process
Lo.P	min. value of the pressure measured in the process
Hi.P	max. value of the pressure measured in the process

7.6.4 Submenu DIS

Parameter	Explanation and setting options	
diS.L	standard process value display L1 = current process value for volumetric flow L2.Temp = current process value for flow and temperature L2.Pres = current process value for volumetric flow and pressure L2.Totl = current process value for volumetric flow and totaliser L3.TP = current process value for volumetric flow and temperature and pressure L4 = current process value for volumetric flow and temperature and pressure and current totaliser value	U
diS.U	update rate of display d1 = high d2 = medium d3 = low	
diS.R	display rotation: 0°, 90°, 180°, 270°	1
diS.B	display brightness: 25 %, 50 %, 75 %, 100 %, OFF (measured value display in the RUN mode switched off)	

7.6.5 Submenu COLR

Parameter	Explanation and setting options
coL.F	colour of the characters in the display for the flow rate value
cFH.F	upper limit of the colour change for flow rate measurement
cFL.F	lower limit of the colour change for flow rate measurement
coL.T	colour of the characters in the display for the temperature value
cFH.T	upper limit of the colour change for temperature measurement
cFL.T	lower limit of the colour change for temperature measurement
coL.P	colour of the characters in the display for the pressure value
cFH.P	upper limit of the colour change for pressure measurement
cFL.P	lower limit of the colour change for pressure measurement

Parameter	Explanation and setting options
coL.V	colour of the characters in the display for the totaliser value
bk/wh	permanently black/white
yellow	permanently yellow
green	permanently green
red	permanently red
r-cF	display colour between limits cFLcFH red, outside green.
G-cF	display colour between limits cFLcFH green, outside red.

7.6.6 Submenu SIM

Parameter	Explanation and setting options
S.FLW	simulated flow coefficient
S.TMP	simulated temperature value
S.PRS	simulated pressure value
cr.UL	measured value below the detection zone $ ightarrow$ error message
UL	measured value below the display range $ ightarrow$ warning
OL	measured value above the display range → warning
cr.OL	measured value above the detection zone $ ightarrow$ error message
S.Tim	simulation time in minutes
S.On	simulation status: OFF, On

8 Set-up

After power on and expiry of the power-on delay time of approx. 1 s, the unit is in the Run mode (= normal operating mode). It carries out its measurement and evaluation functions and generates output signals according to the set parameters. During the power-on delay time the output signal is at 20 mA.

9 Parameter setting



CAUTION

If the medium temperature is above 50 °C (122 °F), parts of the housing can increase in temperature to over 65 °C (149 °F).

- > Risk of burns
- ▶ Do not touch the device with your hands.
- Use another object (e.g. a ballpoint pen) to carry out settings on the unit.

Parameters can be set before installation and set-up of the unit or during operation.



If you change parameters during operation, this will influence the function of the plant.

▶ Ensure that there will be no malfunctions in your plant.

During parameter setting the unit remains in the operating mode. It continues to monitor with the existing parameter until the parameter setting has been completed.

9.1 Parameter setting in general

1.	Change from the RUN mode to the main menu	[•]
2.	Select the requested parameter	[▲] or [▼]
3.	Change to the setting mode	[•]
4.	Change the parameter value	[▲] or [▼] > 1 s
5.	Acknowledge the set parameter value	[•]
6.	Return to the RUN mode	> 30 seconds (timeout)

9.1.1 Select submenu

- 1. Press [●] to change from the process value display to the main menu.
- 2. Press [▼] to select the menu EF and press [●].
- 3. Press [▼] to select the submenu and press [•].

9.1.2 Change to the process value display (RUN mode)

There are 2 possibilities:

 
- 1. Wait for 30 seconds (\rightarrow 9.1.4 Timeout).
- Press [▲] or [▼] to go to the end of the menu and change to the next higher menu.

9.1.3 Lock / unlock

The unit can be locked electronically to prevent unintentional settings. On delivery: not locked.

Lockina:

- ▶ Make sure that the unit is in the normal operating mode.
- Press [▲] and [▼] simultaneously for 10 s until [♠ Set Menu lock] is displayed.



Unlocking:

- ▶ Make sure that the unit is in the normal operating mode.
- ▶ Press [▲] and [▼] simultaneously for 10 s until [Reset menu lock] is displayed.

9.1.4 Timeout

If no button is pressed for 30 s during parameter setting, the unit returns to the operating mode with unchanged values.

9.2 Settings for volumetric flow monitoring

9.2.1 Analogue signal volumetric flow OUT1 or OUT2

 Select [SELx] and set FLOW. Select [ASPx] and set the value at which 4 mA is provided. Select [AEPx] and set the value at which 20 mA is provided. 	Menu OUTx: [SELx] [ASPx] [AEPx]
--	--

9.3 Settings for consumed quantity monitoring

9.3.1 Manual counter reset

▶	Select [rTo] and set rES.T.	Menu EF:	l
>	The totaliser is reset to zero.	[rTo]	

UK

9.3.2 Time-controlled counter reset

\blacktriangleright	Select [rTo] and set the requested value (intervals of hours, days or	Menu EF:	
	weeks).	[rTo]	
>	The totaliser is reset automatically with the value now set.		

9.3.3 Deactivation of the counter reset

	► Select [rTo] and set OFF.	Menu EF:	l
١	> The totaliser is only reset after overflow.	[rTo]	l

9.4 Settings for temperature monitoring

9.4.1 Analogue signal temperature OUT1 or OUT2

► Select [SELx] and set TEMP.	Menu OUTx:
► Select [ASPx] and set the value at which 4 mA is provided.	[SELx]
► Select [AEPx] and set the value at which 20 mA is provided.	[ASPx]
	[AEPx]

9.5 Settings for pressure monitoring

9.5.1 Analogue signal pressure OUT1 or OUT2

 Select [SELx] and set PRES. Select [ASPx] and set the value at which 4 mA is provided. Select [AEPx] and set the value at which 20 mA is provided. 	Menu OUTx: [SELx] [ASPx]	
	[AEPx]	

9.6 User settings (optional)

9.6.1 Standard display

- L1	Femp = current process value for flow and temperature Pres = current process value for volumetric flow and pressure Fotl = current process value for volumetric flow and totaliser	Menu DIS: [diS.L] [diS.U] [diS.R] [diS.B]
- d1 = - d2 = - d3 = Select 0°, 90 Select 25 %, or OF operat	t [diS.U] and set refresh rate of the display: high medium	

9.6.2 Standard unit of measurement for volumetric flow

Select [uni.F] and set unit of measurement for standard display (→ 7.1):

m³/h, l/min, m/s, ft³/h ft³/min, ft/s.

The consumed quantity (meter reading) is automatically displayed in the unit of measurement providing the highest accuracy.

Menu CFG:

[uni.F]

9.6.3 Standard unit of measurement for temperature

Select [uni.T] and set unit of measurement for standard display (\rightarrow 7.1): Menu CFG: °C or °F

9.6.4 Standard unit of measurement for pressure

UK

9.6.5 Measured value damping

	\blacktriangleright	Select [dAP.F] for flow rate measurement or [dAP.P] for pressure	Menu CFG:	
ı		measurement and set damping constant in seconds (τ value 63 %).	[dAP.x]	

9.6.6 Low flow cut-off

standstill. [LFC]

9.6.7 Standard conditions

Select [rEF.P] and set the standard pressure. Select [rEF.T] and set the standard temperature.	Menu CFG: [rEF.P] [rEF.T]
---	---------------------------------

9.6.8 Zero-point calibration pressure

The internal massured value "O" is shifted by this value	
> The internal measured value "0" is shifted by this value.	[coF]

9.6.9 Colour of the characters in the display

- Menu COLR: ► Select [coL.F] for volumetric flow or [coL.T] for temperature or [col.P] for pressure and set the colour of the characters for the process value in [coL.x] the standard display: [cFH.x] [cFL.x] - bk/wh = permanently black/white
 - vellow = permanently yellow - green = permanently green
 - red = permanently red

 - r-cF = display colour red between the limits cFL...cFH, outside colour change to green
 - G-cF = display colour green between the limits cFL...cFH, outside colour change to red
- ► Select [cFH.x] and [cFL.x] and set the limits for the colour window:
 - cFH.F = upper limit for volumetric flow
 - cFL.F = lower limit value for volumetric flow
 - cFH.T = upper limit value for temperature
 - cFL.T = lower limit value for temperature
 - cFH.P = upper limit for pressure
 - cFL.P = lower limit for pressure
- ▶ Select [coL.V] and set the colour of the characters for totaliser:
 - bk/wh = permanently black/white
 - vellow = permanently yellow
 - green = permanently green
 - = permanently red - red

9.6.10 Error behaviour of the outputs OUT1 or OUT2

▶ Select [FOUx] and set error behaviour:

- On = the analogue signal goes to the upper error value (\rightarrow 3.2)
 - OFF = the analogue value goes to the lower error value (\rightarrow 3.2)
 - = the analogue signal goes to 21.5 mA in case of a pressure - OU measurement error and to 3.5 mA in case of a flow or temperature measurement error (\rightarrow 3.2)

[coL.V]

Menu OUTx: [FOUx]

9.6.11 Restore factory setting

UK

9.7 Diagnostic functions

9.7.1 Read min/max values

Select [Lo.x] or [Hi.x] to display the highest or lowest process value measured:	Menu MEM: [Lo.x]
- [Lo.F] = min. value of the flow volume measured in the process - [Hi.F] = max. value of the flow volume measured in the process - [Lo.T] = min. value of the temperature measured in the process - [Hi.T] = max. value of the temperature measured in the process - [Lo.P] = min. value of the pressure measured in the process - [Hi.P] = max. value of the pressure measured in the process	[Hi.x]
Delete memory:	
► Select [Lo.x] or [Hi.x].	
► Keep [▲] and [▼] pressed.	
> [] is displayed.	
► Briefly press [•]].	
It is recommended to delete the memories as soon as the unit operates under normal operating conditions for the first time.	

9.7.2 Simulation

► Select [S.FLW] and set the flow value to be simulated.	Menu SIM:
► Select [S.TMP] and set the temperature value to be simulated.	[S.FLW]
► Select [S.PRS] and set the pressure value to be simulated.	[S.TMP]
► Select [S.Tim] and set the time of the simulation in minutes.	[S.PRS]
► Select [S.On] and set the function:	[S.Tim]
- On = The simulation starts. The values are simulated for the time	[S.On]
set with [S.Tim]. Cancel by pressing any button.	
- OFF = The simulation is not active	

10 Operation

The process values to be displayed permanently can be preset (\rightarrow 9.6.1 Standard display). A standard unit measurement can be defined for the flow rate measurement, the temperature measurement and the pressure measurement (\rightarrow 9.6.2 and \rightarrow 9.6.3 and \rightarrow 9.6.4).

In addition to the preset standard display, the display can be changed by pressing [A] or $[V] \rightarrow 7.1$ Process value display (RUN).

11 Error correction

The unit has many self-diagnostic options. It monitors itself automatically during operation.

Warnings and error states are displayed, even when the display is switched off.

The status signals are classified according to NAMUR recommendation NE107.

If several diagnostic events occur simultaneously, only the diagnostic message of the result with the highest priority is displayed.

If one process value fails, the other process values continue to be available.

Process value line	Title line	Туре	Descrip- tion	Output response	Error correc- tion
ERROR	ERROR	\otimes	Unit faulty / malfunction	FOU	Replace device.
Off	Off	\otimes	Supply voltage too low	Off	Check the supply voltage. Change [diS.B] setting (→ 9.6.1).
PArA	Parame- ter Error	\otimes	Parameter setting outside the valid range	FOU	Repeat parameter setting.
ERROR	Pressure Error	\otimes	Error in pressure measurement	FOU	Check pressure measurement. Replace device.
ERROR	Flow Error	\otimes	Error in flow measurement	FOU	Check flow measurement. Replace device.
ERROR	Temp Error	\otimes	Error in temperature measurement	FOU	Check temperature measurement. Replace device.
cr.OL	Critical over limit	\otimes	Detection zone* exceeded	FOU	Check flow range / temperature range / pressure range.
cr.UL	Critical under limit	\otimes	Detection zone* not reached	FOU	Check temperature range.
OL	Over limit	A	Detection zone* exceeded.	OU	Check flow range / temperature range / pressure range.
UL	Under limit	A	Detection zone* not reached	OU	Check flow range / temperature range / pressure range.
Lock via key		A	Setting buttons on the unit locked, parameter change rejected	OU	Unlock unit → 9.1.3

^{*} Detection zone → 3.2, Figure 1.

Error In the event of an error, the outputs react according to the setting under [FOU1] and [FOU2] (\rightarrow 9.6.10).

Warning

12 Maintenance, repair and disposal

As a rule, no measures for maintenance are necessary.

▶ Define regular calibration intervals according to the process requirements. Recommendation: every 12 months.

Only the manufacturer is allowed to repair the unit.

► After use dispose of the unit in an environmentally friendly way in accordance with the applicable national regulations.

13 Factory setting

Menu	Parameter	Factory setting	User setting
EF	rTo	OFF	
OUT1	SEL1	TEMP	
	ASP1	0 %	
	AEP1	100 %	
	FOU1	OFF	
OUT2 SEL2		FLOW	
	ASP2	0 %	
	AEP2	100 %	
	FOU2	OFF	

Menu	Parameter	Factory	setting	User setting
CFG	uni.F	m³/h		
	uni.T	°()	
	uni.P	ba	ar	
	dAP.F	0,6 s		
	dAP.P	0,0	6 s	
	LFC	0555 6451	0,1 m³/h	
		0555 6452	$0,3 \text{ m}^3/\text{h}$	
		0555 6453	0,5 m³/h	
		0555 6454	2,0 m³/h	
	rEF.P	1013 mbar		
	rEF.T	15 °C		
	coF	0		
DIS	diS.L	L3.	TP	
	diS.U	d3		
	diS.R	0		
	diS.B	75		
COLR	coL.F	bk/wh		
	coL.T	bk/	wh	
	coL.P	bk/	wh	
	coL.V	bk/	wh	

The percentage values refer to the final value of the measuring range (MEW).